

Property Damage Specialist
P O Box 2002, Indio, CA 92201
(760) 275-6795
Fax: (760) 863-5349
Email: PDS9593@VERIZON.NET

APPRAISAL REPORT

DAMAGE ASSESSED BY: Roberta Kear

FILE NUMBER: CO13101950
CLAIM NUMBER: CO13101950
DATE OF LOSS: 6/23/2013
TYPE OF LOSS: Collision
APPRAISED FOR: ROBERT MORINO INS - STEPHANIE BRON

ASSIGNMENT DATE: None
CONTACT DATE: 6/26/2013
INSPECTION DATE: 6/27/2013
REC'D DATE: None

Point(s) of Impact

7 Left Rear Corner (P), 2 Right Front Side (S)

INSURED: EVGUENIA RAHAVI
1609 MICHAEL LANE
PACIFIC PALISADES, CA 90272
(310) 766-3700

CLAIMANT: None

OWNER: EVGUENIA RAHAVI
1609 MICHAEL LANE
PACIFIC PALISADES, CA 90272
(310) 766-3700

BODY SHOP: CUSTOM AUTO CRAFT COLLISIONI CENTERS
100 N. LA BREA AVE.
LOS ANGELES, , CA 90036
(323) 936-1515

Anthony

FAX: (323) 954-9220
95-4408508

INSPECTION SITE: CUSTOM CRAFT COLLISION
100 N. LA BREA AVE.
LOS ANGELES, CA 90036

QUALITY RECYCLED PARTS: Yes
AFTERMARKET NEW PARTS: Yes
VEHICLE DRIVEABLE: No

Comments:

06/27/2013 Inspected insured's 2000 Mercury Grand Marquis at Custom Auto Craft at approx 1:15 pm, met with Anthony at shop, noted damage to left rear, windshield and lt front tire of cust vehicle, approx repair time is 7 days.

This was a moderate impact to the left rear of cust vehicle, it appears other vehicle went under this vehicle and pushed it into the curb causing damage to the windshield and rt front tire. Located lkg rear bumper assy at Crossroads, nego frame/repair time to all panels, repl rt frt tire no betterment as new tire (11/32) and safelite for windshield. Agreed to allow 4 wheel alignment due to type of impact. Did not see vin on door, took from dash. Open items include minor additional internal after tear down but nothing major. This vehicle is repairable. Towing was 224.00 and a copy is incl.

I emailed a copy of this estimate to the shop at
customautoccc@gmail.com

COMPARISON ESTIMATE:	0.00	TOWING:	0.00	ACTUAL CASH VALUE:	5,862.00
APPRAISER ESTIMATE:	2,295.41	STORAGE:	0.00	SALVAGE VALUE:	0.00
AGREED UPON AMOUNT:	0.00	DEDUCTIBLE:	975.00	SETTLEMENT:	0.00
				REPAIR VS. ACV:	0.00
DRAFT/CHECK NUMBER:	0			ESTIMATE FEE:	0.00
DRAFT/CHECK AMOUNT:	0.00			TRAVEL EXPENSE:	0.00
DATE ISSUED:	None			PHOTO EXPENSE:	0.00
				MISC EXPENSE:	0.00
				TOTAL CHARGES:	0.00

Date: 6/30/2013 10:50 AM
 Estimate ID: CO13101950
 Estimate Version: 0
 Preliminary
 Profile ID: * PDS

FOR SUPPLEMENTS CALL RICH PEREA 760-275-6795 OR EMAIL
 PDS9593@VERIZON.NET

Property Damage Specialist

P O Box 2002, Indio, CA 92201
 (760) 275-6795
 Fax: (760) 863-5349
 Email: PDS9593@VERIZON.NET

Damage Assessed By: Roberta Kear

Appraised For: ROBERT MORINO INS - STEPHANIE BRON

Condition Code: Good
 Date of Loss: 6/23/2013
 Contact Date: 6/26/2013
 Deductible: 975.00
 File Number: CO13101950
 Claim Number: CO13101950

Type of Loss: Collision

Insured: EVGUENIA RAHAVI
 Owner: EVGUENIA RAHAVI
 Address: 1609 MICHAEL LANE, PACIFIC PALISADES, CA 90272
 Telephone: Home Phone: (310) 766-3700

Mitchell Service: 910624

Description: 2000 Mercury Grand Marquis LS
 Body Style: 4D Sed
 VIN: 2MEFM75W0YX675797
 Mileage: 74,310
 OEM/ALT: A
 Color: WHITE
 Options: PASSENGER AIRBAG, DRIVER AIRBAG, POWER DRIVER SEAT, POWER LOCK, POWER WINDOW
 REAR WINDOW DEFOGGER, MANUAL AIR CONDITION, CRUISE CONTROL, TILT STEERING COLUMN
 FOG LIGHTS, ALUM/ALLOY WHEELS, LEATHER STEERING WHEEL
 POWER ADJUSTABLE EXTERIOR MIRROR, TINTED GLASS, AUTO AIR CONDITION
 VARIABLE ASSISTED STEERING, ANTI-THEFT SYSTEM, AUTOMATIC HEADLIGHTS
 AM/FM STEREO CASSETTE, FRONT SEATS WITH POWER LUMBAR SUPPORT
 KEYLESS ENTRY SYSTEM, POWER DISC BRAKES, POWER LIFTGATE\TRUNK
 STEERING WHEEL MOUNTED CONTROLS

Drive Train: 4.6L Inj 8 Cyl 4A
 License: 5MWB512 CA

Search Code: None

Line Item	Entry Number	Labor Type	Operation	Line Item Description	Part Type/ Part Number	Dollar Amount	Labor Units
<u>MANUAL ENTRIES</u>							
1	900500	BDY *	REMOVE/REPLACE	RIGHT FRONT TIRE	** QUAL REPL PART	129.95 *	0.0*
2				VEH PUSHED INTO CURB WHEN IMPACTED			
<u>Windshield</u>							
3	002121	GLS	REMOVE/REPLACE	W/Shield Glass	Sublet	233.50 *	0.0* #
4				SAFELITE AUTO GLASS 800-800-2727			
5				CRACKED WHEN PUSHED INTO CURB			
<u>Rear Door</u>							
6	000801	REF	BLEND	L Rear Door Outside			C 1.0
7	000819	BDY	REMOVE/INSTALL	L Rear Window Mldg			0.5 #
8	000821	BDY	REMOVE/INSTALL	L Rear Otr Door Belt Weatherstrip			0.3
9	000891	BDY	REMOVE/INSTALL	L Rear Door Trim Panel			INC
10	000921	BDY	REMOVE/INSTALL	L Rear Door Handle			0.7 #
<u>Quarter Panel</u>							

ESTIMATE RECALL NUMBER: 06/30/2013 10:50:47 CO13101950

Mitchell Data Version: OEM: MAY_13_V
 MAPP:MAY_13_V

Software Version: 7.0.485

Copyright (C) 1994 - 2013 Mitchell International
 All Rights Reserved

Page 1 of 4

Date: 6/30/2013 10:50 AM
Estimate ID: CO13101950
Estimate Version: 0
Preliminary
Profile ID: * PDS

11	001018	BDY	REPAIR	L Quarter Outer Panel	Existing		12.0* #
12		REF	REFINISH	L Quarter Panel Outside		C	2.4
13				AFTER PULL			
14	001037	BDY	REMOVE/INSTALL	L Lwr Quarter Trim Panel	Existing		0.5 r
				<u>Luggage Lid</u>			
15	001041	REF	BLEND	Luggage Lid Outside		C	1.1
				<u>Rear Body</u>			
16	001137	BDY	REPAIR	Rear Body Panel	Existing		2.0* #
17		REF	REFINISH	Rear Body Panel		C	0.6
18				AFTER PULL			
19	001140	BDY	REPAIR	Rear Body Floor Pan	Existing		4.0* #
20				AFTER PULL			
				<u>Rear Lamps</u>			
21	001153	BDY	REMOVE/INSTALL	L Rear Combination Lamp			0.5
22	001165	BDY	REMOVE/INSTALL	Rear Reflector Lamp Assy			0.3 #
				<u>Rear Bumper</u>			
23		BDY	OVERHAUL	Rear Bumper Cover Assy			2.0
24	001187	BDY	REMOVE/REPLACE	Rear Bumper Cover	Qual Recycled Part	450.00 * INC	r
25		REF	REFINISH	Rear Bumper Cover		C	2.8
26				CROSSROADS FORD 951-685-7421			
27	001189	BDY	REMOVE/REPLACE	R Rear Bumper Cover Moulding	Qual Recycled Part	0.00 * INC	
28				INCL W/LKQ ASSY			
29	001316	BDY	REMOVE/REPLACE	L Rear Bumper Cover Moulding	Qual Recycled Part	0.00 * INC	
30				INCLUDED W/LKQ ASSY			
31	001194	BDY	REMOVE/REPLACE	Rear Bumper Reinforcement Bar	Qual Recycled Part	0.00 * INC	r
32				INCLUDED W/LKQ ASSY			
33	001197	BDY	REMOVE/REPLACE	R Rear Bumper Isolator	Qual Recycled Part	0.00 * 0.2 #	
34				INCLUDED W/LKQ ASSY			
35	001198	BDY	REMOVE/REPLACE	L Rear Bumper Isolator	Qual Recycled Part	0.00 * 0.2 #	
36				INCLUDED W/LKQ ASSY			
				<u>FRAME</u>			
37	931105	MCH	ADD'L LABOR OP	FOUR WHEEL ALIGNMENT	Sublet	79.95 * 0.0*	
38				CONCESSION TO REACH AGREED PRICE			
				<u>Rear Bumper</u>			
39	002596	BDY	REMOVE/REPLACE	Rear Ctr Bumper Reinf Support	Qual Recycled Part	0.00 * INC	
40				INCLUDED W/LKQ ASSY			
				<u>Additional Costs & Materials</u>			
41	936012		ADD'L COST	Hazardous Waste Disposal		3.00 *	
42	936014		ADD'L COST	Flex Additive		8.00 *	
				<u>FRAME</u>			
43	933006	FRM	ADD'L OPR	FRAME/RACK SET UP			2.0*
44	933031	FRM	ADD'L OPR	PULL FOR MASH			2.0*
				<u>MANUAL ENTRIES</u>			
45	900500	BDY *	REMOVE/REPLACE	Mask Jams for primer	** QUAL REPL PART	2.50 * 0.2*	
				<u>ADDITIONAL OPERATIONS</u>			
46		REF	ADD'L OPR	Clear Coat			2.1
				<u>ADDITIONAL REFINISH OPERATIONS</u>			
47	933003	BDY *	ADD'L OPR	TINT COLOR			0.5*
				<u>Additional Operations</u>			
48	933005	BDY	ADD'L OPR	Restore Corrosion Protection		8.00 *	
49	933017	BDY *	ADD'L OPR	Finish Sand And Buff			1.5*
50				.5 PER SHEET METAL PANEL			
				<u>ADDITIONAL REFINISH OPERATIONS</u>			
51	933018	REF	ADD'L OPR	MASK FOR OVERSPRAY		5.00 * 0.3*	
				<u>Additional Operations</u>			
52	933020	REF	ADD'L OPR	Painted Stripe		35.00 *	
53	933026	BDY	ADD'L OPR	LKQ Part Cleanup			1.0*
				<u>Additional Costs & Materials</u>			
54			ADD'L COST	Paint/Materials		340.00 *	

ESTIMATE RECALL NUMBER: 06/30/2013 10:50:47 CO13101950

Mitchell Data Version: OEM: MAY_13_V

Software Version: MAPP:MAY_13_V

7.0.485

Copyright (C) 1994 - 2013 Mitchell International
All Rights Reserved

Page 2 of 4

* - Judgment Item
- Labor Note Applies
C - Included in Clear Coat Calc
r - CEG R&R Time Used For This Labor Operation

Estimate Totals

I. Labor Subtotals						II. Part Replacement Summary				Amount
	Units	Rate	Add'l Labor Amount	Sublet Amount	Totals					
Body	26.4	45.00	8.00	0.00	1,196.00	Taxable Parts				582.45
Refinish	10.3	45.00	40.00	0.00	503.50	Sales Tax	@	9.000%		52.42
Frame	4.0	60.00	0.00	0.00	240.00					
Mechanical	0.0	95.00	0.00	79.95	79.95	Non-Taxable Parts				233.50
Non-Taxable Labor					2,019.45	Total Replacement Parts Amount				868.37
Labor Summary	40.7				2,019.45					
III. Additional Costs					Amount	IV. Adjustments				Amount
Taxable Costs					351.00	Insurance Deductible				975.00-
Sales Tax					@ 9.000% 31.59	Customer Responsibility				975.00-
Total Additional Costs					382.59					
Paint Material Method: Rates Init Rate = 34.00 , Init Max Hours = 99.9, Addl Rate = 0.00										
						I.	Total Labor:			2,019.45
						II.	Total Replacement Parts:			868.37
						III.	Total Additional Costs:			382.59
							Gross Total:			3,270.41
						IV.	Total Adjustments:			975.00-
							Net Total:			2,295.41

Date: 6/30/2013 10:50 AM
Estimate ID: CO13101950
Estimate Version: 0
Preliminary
Profile ID: * PDS

Inspection Site: CUSTOM CRAFT COLLISION
Address: 100 N. LA BREA AVE.
LOS ANGELES, CA 90036
(323) 936-1515
Inspection Date: 6/27/2013

Body Shop: CUSTOM AUTO CRAFT COLLISIONI CENTERS
100 N. LA BREA AVE.
LOS ANGELES, , CA 90036
Telephone: (323) 936-1515
Fax Phone: (323) 954-9220
State Lic. No: 95-4408508

"THIS IS NOT AN AUTHORIZATION FOR REPAIR NOR A GUARANTEE OF PAYMENT.
YOU MUST CONTACT THE INSURANCE COMPANY TO CONFIRM COVERAGES AND
PAYMENT. THIS APPRAISAL IS SUBJECT TO REVIEW AND ADJUSTMENT."



QUICKSILVER TOWING

5875 RODEO ROAD
LOS ANGELES, CA 90016
(310) 478-1201
MC#0145706



277138

STORAGE NO.		CALL NO.	
CUSTOMER <u>Custom auto crash</u>		DATE <u>6-24-13</u>	REPAIR ORDER NO.
ADDRESS <u>100 N. Labrea Blvd</u>		PO NO.	UNIT NO.
OWNER NAME <u>IRAJ RAHATI</u>		DRIVER NO. <u>(1) Pat 10</u>	CHARGE
MAKE <u>Mercury</u>	YEAR <u>00</u>	VIN NUMBER <u>2MEFM75W0X605792</u>	PAID
TOWED FROM <u>Pat's auto DR. & Veda de la manta</u>			LIST
TOWED TO <u>100 N. Labrea</u>			224
ARRIVED:	TOW:	COMPLETED: <u>10:20</u>	
SERV CALL TYPE	SERV LOCATION		
2nd TOW TO			
DRIVESTAFF REMOVED UNINSTALLED	AXES REMOVED UNINSTALLED	ADVANCE CHARGES	INV. NO.
KEYS RELEASED TO (SIGNATURE)	DRIVERS LIC. NO.		
AUTHORIZED BY (SIGNATURE)		Upon request, you are entitled to receive a copy of the Towing Fees and Access Notice	
AUTHORIZED BY (PRINTED)		TOTAL <u>224</u>	

VEHICLE RELEASE HOURS 7:00 A.M. - 7:00 P.M. DAILY
































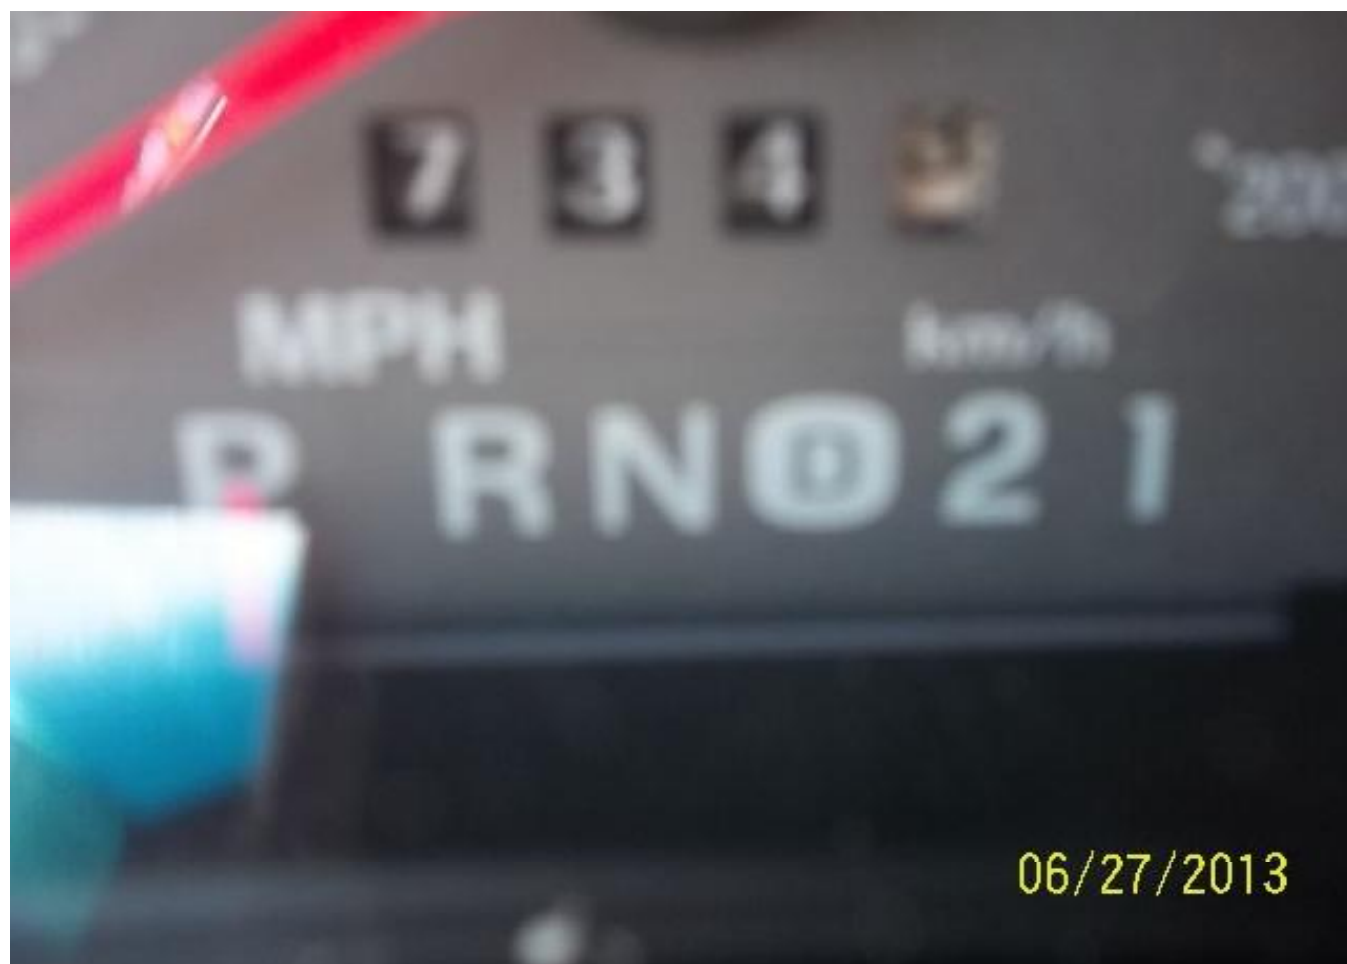



REGISTRATION VALID FROM 08/20/2012 TO 08/20/2013 TYPE 11 LICENSE NUMBER 4MWB512

VEHICLE IDENTIFICATION NUMBER 2MEFM75W0YX675797

MAKE MERC

DATE FIRST SOLD 00/00/2000 CLASS EQ Yr. Model 2000

DATE ISSUED 07/17/2012

TYPE	VER	MP	AX	WC	UNLADEN/GCW	TOTAL FEES PAID
120	G					\$99

1900

REGISTERED OWNER

RAHAVI EVGUENIA
1609 MICHAEL LN
PACIFIC PLSDS CA 90272-2029

0

STATE OF CALIFORNIA
DEPARTMENT OF MOTOR VEHICLES
REGISTERED REGISTRATION CARD
REVERSE SIDE - IMPORTANT INSTRUCTIONS

R0069
L0020

141070320120920

J9572028

06/27/2013








Ford Motor Company
VEHICLE EMISSION CONTROL INFORMATION

This vehicle is equipped with electronic engine control systems. Engine idle speed, idle mixture, and ignition timing are not adjustable. See Powertrain Control/Emissions Diagnosis Manual for additional information.

Use SAE 5W-30
AMERICAN PETROLEUM
INSTITUTE CERTIFIED
OILS for GASOLINE
ENGINES.

This vehicle conforms to U.S.
EPA NLEV regulations
applicable to gasoline fueled
2000 model year new LEV
motor vehicles and to
California regulations
applicable to 2000 model
year new LEV passenger
cars. OBD II certified.

VACUUM HOSE ROUTING

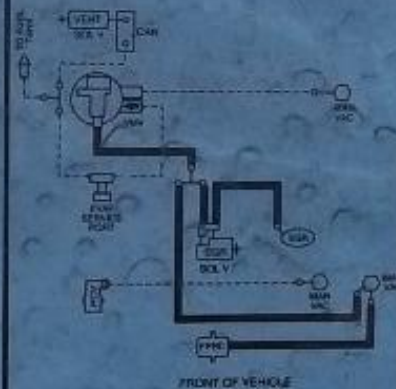

46VBGFFG

YW7E-9C485-
G F Z

Catalyst

Spark Plug Gap: .052-.056
4.6 L-YFMXR0115BAE
YFMXV04.6VFR-2TWC(2V2HO2S(2V)EGR/SFI

06/27/2013



06/27/2013



